



Connect. Accelerate. Outperform.™

Mellanox DPDK Release Notes

Rev 2.2_3.9

www.mellanox.com

NOTE:

THIS HARDWARE, SOFTWARE OR TEST SUITE PRODUCT (“PRODUCT(S)”) AND ITS RELATED DOCUMENTATION ARE PROVIDED BY MELLANOX TECHNOLOGIES “AS-IS” WITH ALL FAULTS OF ANY KIND AND SOLELY FOR THE PURPOSE OF AIDING THE CUSTOMER IN TESTING APPLICATIONS THAT USE THE PRODUCTS IN DESIGNATED SOLUTIONS. THE CUSTOMER'S MANUFACTURING TEST ENVIRONMENT HAS NOT MET THE STANDARDS SET BY MELLANOX TECHNOLOGIES TO FULLY QUALIFY THE PRODUCT(S) AND/OR THE SYSTEM USING IT. THEREFORE, MELLANOX TECHNOLOGIES CANNOT AND DOES NOT GUARANTEE OR WARRANT THAT THE PRODUCTS WILL OPERATE WITH THE HIGHEST QUALITY. ANY EXPRESS OR IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT ARE DISCLAIMED. IN NO EVENT SHALL MELLANOX BE LIABLE TO CUSTOMER OR ANY THIRD PARTIES FOR ANY DIRECT, INDIRECT, SPECIAL, EXEMPLARY, OR CONSEQUENTIAL DAMAGES OF ANY KIND (INCLUDING, BUT NOT LIMITED TO, PAYMENT FOR PROCUREMENT OF SUBSTITUTE GOODS OR SERVICES; LOSS OF USE, DATA, OR PROFITS; OR BUSINESS INTERRUPTION) HOWEVER CAUSED AND ON ANY THEORY OF LIABILITY, WHETHER IN CONTRACT, STRICT LIABILITY, OR TORT (INCLUDING NEGLIGENCE OR OTHERWISE) ARISING IN ANY WAY FROM THE USE OF THE PRODUCT(S) AND RELATED DOCUMENTATION EVEN IF ADVISED OF THE POSSIBILITY OF SUCH DAMAGE.



Mellanox Technologies
350 Oakmead Parkway Suite 100
Sunnyvale, CA 94085
U.S.A.
www.mellanox.com
Tel: (408) 970-3400
Fax: (408) 970-3403

© Copyright 2016. Mellanox Technologies LTD. All Rights Reserved.

Mellanox®, Mellanox logo, BridgeX®, CloudX logo, Connect-IB®, ConnectX®, CoolBox®, CORE-Direct®, EZchip®, EZchip logo, EZappliance®, EZdesign®, EZdriver®, EZsystem®, GPUDirect®, InfiniHost®, InfiniScale®, Kotura®, Kotura logo, Mellanox Federal Systems®, Mellanox Open Ethernet®, Mellanox ScalableHPC®, Mellanox Connect Accelerate Outperform logo, Mellanox Virtual Modular Switch®, MetroDX®, MetroX®, MLNX-OS®, NP-1c®, NP-2®, NP-3®, Open Ethernet logo, PhyX®, SwitchX®, Tiler®, Tiler logo, TestX®, The Generation of Open Ethernet logo, UFM®, Virtual Protocol Interconnect®, Voltaire® and Voltaire logo are registered trademarks of Mellanox Technologies, Ltd.

All other trademarks are property of their respective owners.

For the most updated list of Mellanox trademarks, visit <http://www.mellanox.com/page/trademarks>

Contents

1 Overview	5
1.1 System Requirements	5
2 Changes and Major New Features in Rev 2.2_3.9	6
3 mlx4 and mlx5 PMD Drivers Features.....	7
4 Known Issues	8
4.1 General Known Issues	8
4.2 mlx4 PMD Known Issues.....	8
4.3 mlx5 PMD Known Issue	9
5 Bug Fixes	12
5.1 ConnectX-4 PMD Bug Fixes.....	12
5.2 ConnectX-3 PMD Bug Fixes.....	14
5.3 DPDK v2.2 Bug Fixes.....	15
6 Change Log History	17

List of Tables

Table 1: System Requirements	5
Table 2: Changes and Major New Features.....	6
Table 3: General Known Issues	8
Table 4: mlx4 PMD Known Issues	8
Table 5: ConnectX-4 PMD Bug Fixes	12
Table 6: DPDK v2.2 Bug Fixes.....	15
Table 7: Change Log History.....	17

1 Overview

These are the release notes for mlx4 and mlx5 DPDK Poll-Mode Driver (PMD) for Mellanox ConnectX®-3/ConnectX®-3 Pro and ConnectX®-4/ ConnectX®-4 Lx Ethernet adapters.

1.1 System Requirements

Table 1: System Requirements

Specification	Value
Network Adapter Cards	ConnectX®-3 / ConnectX®-3 Pro / ConnectX®-4 / ConnectX®-4 Lx network adapter card. (These must be configured to work in ETH mode.)
Firmware	<ul style="list-style-type: none"> ConnectX 4: 12.16.1020 ConnectX-4 Lx: 14.16.1020 ConnectX 3/ ConnectX-3 Pro: 2.36.5000
Linux Driver Stack	MLNX_OFED- 3.3-1.0.2.0
ESXi 6.0 Driver	ConnectX-4 / ConnectX-4 Lx: 4.15.5-10
ESXi 5.5 U1 Driver	ConnectX-4 / ConnectX-4 Lx: 4.5.5-10
Operating Systems and Kernels	All OSs supported by MLNX_OFED
Minimum memory requirements	16 GB RAM
Transport	Ethernet
CPU Arch	x86, Power8

2 Changes and Major New Features in Rev 2.2_3.9

Table 2: Changes and Major New Features

Driver	Changes
ConnectX-4 PMD, mlx5	<ul style="list-style-type: none"> • Merged “txq_inline” and “txq_inline_new” to a single parameter, “txq_inline” • Added support for Power8 • Automatic inline send: Automatic decision will be made according to the rate whether TX inline needs to be used or not. • CPU performance optimizations • Bug fixes for mlx5 and mlx4
ConnectX-3 PMD, mlx4	Added link up/down callback functions support
DPDK v2.2	<ul style="list-style-type: none"> • Backport changes/fixes from DPDK 16.07 • mbuf: add prefetch helpers: Enables the drivers to prefetch the RX or TX part of the mbuf, regardless of the cache line size. Note: Some architectures (ex: Power8) have a cache line size of 128 bytes, so the drivers should not expect that prefetching the second part of the mbuf with <code>rte_prefetch0 (&m->cacheline1)</code> to be valid. • mbuf: add raw allocation function: Added a new new public function in <code>rte_mbuf</code> to allocate a raw mbuf (uninitialized)

3 mlx4 and mlx5 PMD Drivers Features

Feature	mlx4 PMD	mlx5 PMD
Supported NICs	ConnectX®-3 ConnectX®-3 Pro	ConnectX®-4 ConnectX®-4 Lx
PCI mapping	Function per device	Function per port
KVM SR-IOV	Yes	Yes
ESX 6.0 SR-IOV	Yes	Yes
ESX 5.5 SR-IOV	No	Yes
Scattering/gathering RX/TX packets	Yes	Yes
Multiple RX (with RSS/RCA) and TX queues	Yes	Yes
IPv4, TCP IPv4, UDP IPv4 RSS	Yes	Yes
IPv6 RSS	Yes	Yes
VXLAN RSS	Yes	According to the outer header
Number of RSS queues	Power of 2	Any
Get and Set RSS key per flow type (rss_hf)	No	Yes
Multiple MAC addresses	Yes	Yes
VLAN filtering	Yes	Yes
Link state information	Yes	Yes
Software counters/statistics	Yes	Yes
Start/stop/close operations	Yes	Yes
Multiple physical ports host adapter	Yes	Yes
Promiscuous mode	Yes	Yes
Multicast Promiscuous	Yes	Yes
Checksums hardware offloading	Yes	Yes
Checksum VXLAN hardware offloading	Yes	No
Flow Director	No	Yes
RX VLAN stripping	No	Yes
TX VLAN insertion	No	Yes

4 Known Issues

4.1 General Known Issues

Table 3: General Known Issues

Subject	Description	Workaround
InfiniBand	Mellanox PMDs does not support InfiniBand.	N/A
Support for DPDK integrated shared library	Mellanox PMDs does not support DPDK integrated shared library	PMD compiled as shared library can be used
Hardware counters	Hardware counters are not implemented.	N/A
The Primary and Secondary multi process model	The Primary and Secondary multi process model is currently supported in TX only.	Use multithreaded model instead of multi process in case mutli process RX is needed
Active - Passive Bonding mode	Bond PMD does not configure the needed MAC address to Bond slaves in case of failover. Active-Passive Bonding mode is available in case of KVM SR-IOV when 2 VMs are configured with the same MAC.	
Bond LAG interface is down	Bond PMD does not notice when Mellanox PMD's ports are up	Run ifconfig down and up on the bond slaves of the Mellanox interfaces

4.2 mlx4 PMD Known Issues

Table 4: mlx4 PMD Known Issues

Subject	Description	Workaround
Multicast / Broadcast Self-loopback on SR-IOV VF	When a Multicast or Broadcast packet is sent to the SR-IOV VF, it is returned back to the port.	N/A
Performance degradation when SGE_NUM =4	Performance degradation might occur for small packets when PMD is compiled with SGE_NUM = 4 compared to the performance when SGE_NUM = 1	If scattered packets are not used, compile PMD with SGE_NUM = 1
Hardware checksum offloading on ConnectX-3	Hardware checksum offloading is not supported in ConnectX-3	Use ConnectX3-Pro if hardware checksum offloading is needed
Sending abnormal packets	Sending abnormal packets, smaller then 16B and bigger than the configured MTU causes PMD queues to enter an error state.	run dev_stop and dev_start

Subject	Description	Workaround
ESX 6.0 and DMFS A0 mode	DMFS A0 mode is not supported in ESX 6.0 VM	N/A
ESX 6.0 and HW checksum offloading	RX hardware checksum offloads are not supported in ESX 6.0 VM	N/A
ESX 6.0 and “add MAC”	Only one additional MAC can be added in additional to the VF’s MAC in ESX 6.0 VM	N/A
VXLAN hardware checksum offloading	VXLAN hardware checksum offloading is supported only if the used kernel supports it	N/A
L4 checksum report with hardware checksum offloading	When the packet does not include TCP/UDP header and the hardware checksum offloading is enabled, L4 checksum will be reported as bad	N/A
RSS	RSS hash key and options cannot be modified.	N/A
Promiscuous and SR-IOV	Promiscuous mode does not work when SR-IOV is enabled.	N/A
Promiscuous and SR-IOV	In testpmd: Although promiscuous mode fails in SR-IOV, it still shows as enabled This is DPDK implementation bug.	N/A
VLAN filtering	VLAN filtering is supported only with non-optimized steering mode.	See QSG, RX VLAN Filter section
Number of configured RSS queues must be power of 2	Number of configured RSS queues must be power of 2.	Use only power of 2 RSS queues
Broadcast packets and VLAN filter on KVM VM	Broadcast packets with VLAN are not received when VLAN filter is configured on KVM VM	N/A
MLNX OFED 2.4	MLNX_OFED 2.4 and below is not supported	It is recommended to use MLNX_OFED 3.3

4.3 mlx5 PMD Known Issue

Table 4: mlx5 PMD Known Issues

Subject	Description	Workaround
Auto inline	Auto inline feature is supported only on a single port ConnectX-4 adapter card (is not supported on ConnectX-4 Lx) and cannot be used for 0 packet loss performance	Use auto-inline only with supported mode
LCS events	When using default firmware configuration, LCS events are not received when <code>rte_eth_dev_set_link_down/up</code> are called.	Run <code>mlxconfig -d /dev/mst/mt4115_pciconf0 set KEEP_ETH_LINK_</code>

Subject	Description	Workaround
		UP_P1=0 KEEP_ETH_LINK_ UP_P2=0 Reboot the server.
LCS events on VM	LCS events are not received on KVM/ESX VM when <code>rte_eth_dev_set_link_down/up</code> are called.	N/A
VXLAN HW Checksum offloading	VXLAN HW Checksum offloading is not supported	Will be added in next releases
VXLAN RSS	VXLAN traffic is spread between RSS queues according to the outer header	Will be added in next releases
Flow director VXLAN filter	Flow director VXLAN filter is not supported	Will be added in next releases
The dest MAC of the sent packet	When destination MAC of a sent packet is the same as the port's MAC, the packet is returned to the port and is not sent to the network. Note: On ConnectX-4 Lx, the packet is sent when <code>txq_mpw_en</code> is set to 1 (the default configuration).	N/A
RSS with non-power of 2 RX queues performance	When the number of RX queues is not power of 2, the RETA table size is automatically configured to 256 to achieve the best flows spreading. Still in some cases traffic spreading between the queues can be non-equal	Use power of 2 number of queues if possible
Maximum supported size of TX/RX queue	The maximum supported number of descriptors in TX/RX queues is equal to 32K. When <code>txq_inline</code> parameter is used the number is smaller and is equal to $32K/(txq_inline/32 + 1)$. When auto-inline is used, the maximum supported number of descriptor is 6K If the number of descriptors of TX or RX queues is higher than the above maximum, segmentation fault will occur	Use maximum number of TX and RX descriptors as explained.
IPv6 Multicast packets	IPv6 Multicast packets are not being received if multicast promiscuous mode is not enabled	N/A
Performance of small messages when MTU > mbuf size	Performance degradation of small messages might occur when MTU is higher than the mbuf size	N/A
VLAN packets on KVM VM	VLAN packets are received but are not sent when DPDK is running on KVM VM	N/A

Subject	Description	Workaround
RX VLAN Stripping has unexpected behavior	DPDK has a flag per port to indicate the VLAN stripping state (On/Off), that updated when using <code>rte_eth_dev_set_vlan_offload()</code> API. This flag is not updated when calling the <code>rte_eth_dev_set_vlan_strip_on_queue()</code> API (VLAN stripping per queue), and can cause some confusion when mixing between those two APIs.	Use only one API to configure RX stripping
TX VLAN insertion offloading with ConnectX-4 LX	TX VLAN offloading insertion is supported only when <code>txq_mpw_en</code> is set to 0. By default is not supported since MPW is enabled	Set <code>txq_mpw_en=0</code> . Please check the Quick Start Guide for more information regarding command line options.
Changing MTU during traffic	Changing MTU during traffic results in segmentation fault.	Stop the ports before changing the MTU
Flow Control settings on KVM VM	Flow Control settings are not allowed on VM	Set Flow Control settings on the Hypervisor
Allmulticast on KVM and ESX VM	Allmulticast on VM is not supported	N/A
Adding unicast MAC on ESX VM is not supported	ESX VM supports only a single unicast MAC	N/A
MTU configuration on KVM VM	When configuring the MTU on the VM make sure the MTU on the hypervisor is the same as on the VM	N/A
Flow director on ESX VM	Flow director is not supported on ESX VM	N/A
RSS IP performance degradation	Performance degradation might occur when running DPDK application with RSS IP and using firmware 14.16.1006 / 12.16.1006.	Upgrade firmware to version 14.16.1020 / 12.16.1020.

5 Bug Fixes

5.1 ConnectX-4 PMD Bug Fixes

Table 5: ConnectX-4 PMD Bug Fixes

Internal Ref.	Issue
-	<p>Description: Fixed data corruption in case of mbuf allocation failure</p> <p>Key Words: Data corruption</p> <p>Discovered in Release: MLNX_DPDK 2.2._2.7</p> <p>Fixed in Release: MLNX_DPDK 2.2_3.9</p>
-	<p>Description: Fixed link status report when LSC events were configured</p> <p>Key Words: LCS events</p> <p>Discovered in Release: MLNX_DPDK 2.2._2.7</p> <p>Fixed in Release: MLNX_DPDK 2.2_3.9</p>
-	<p>Description: Fixed RX VLAN offload capability report. This capability was implemented but not reported</p> <p>Key Words: VLAN offload capability report</p> <p>Discovered in Release: MLNX_DPDK 2.2._2.7</p> <p>Fixed in Release: MLNX_DPDK 2.2_3.9</p>
-	<p>Description: Modified the function <code>priv_set_flags</code> (<code>priv</code>, <code>keep</code>, <code>flags</code>) behavior. Now the "keep" mask is no longer ignored.</p> <p>Key Words: Setting interface flags</p> <p>Discovered in Release: MLNX_DPDK 2.2._1.6</p> <p>Fixed in Release: MLNX_DPDK 2.2_3.9</p>
-	<p>Description: Fixed an issue that caused VLAN filters removal when two VLAN filters were configured and one was removed. In this case, the second was also removed by mistake.</p> <p>Key Words: VLAN filter</p> <p>Discovered in Release: MLNX_DPDK 2.2._1.6</p> <p>Fixed in Release: MLNX_DPDK 2.2_3.9</p>
-	<p>Description: Fixed inconsistent return value in Flow Director</p> <p>Key Words: Flow director return error code</p> <p>Discovered in Release: MLNX_DPDK 2.2._1.6</p> <p>Fixed in Release: MLNX_DPDK 2.2_2.7</p>
-	<p>Description: By default, <code>testpmd</code> configures CRC to be scattered by the HW, but it does not strip the CRC header.</p> <p>ConnectX-4 adds CRC header for every packet that is sent. In case of IO forwarding on a loopback setup, the forwarded packet increases each send by 4B</p>

Internal Ref.	Issue
	Key Words: testpmd application and CRC stripping
	Discovered in Release: MLNX_DPDK 2.2._1.6
	Fixed in Release: MLNX_DPDK 2.2_2.7
-	Description: Fixed an issue that resulted in the following error when working with MTU > 2048 and the PMD is compiled with SGE_NUM=4: mlx5: got completion with error:
	Key Words: Jumbo frames
	Discovered in Release: MLNX_DPDK 2.2._1.4
	Fixed in Release: MLNX_DPDK 2.2_1.6
-	Description: Avoid packet duplication with overlapping Flow Director rules. For example the case where Flow Director mask is zero and the value is not
	Key Words: Flow Director: zero values
	Discovered in Release: MLNX_DPDK 2.2._1.4
	Fixed in Release: MLNX_DPDK 2.2_1.6
-	Description: Fixed an error which occurred when the software configured FCS stripping or HW padding which were not supported by the firmware.
	Key Words: HW capabilities check
	Discovered in Release: MLNX_DPDK 2.2._1.4
	Fixed in Release: MLNX_DPDK 2.2_1.6
-	Description: Fixed a faulty L4 checksum which was reported when the packet is L3
	Key Words: L4 checksum of L3 packet
	Discovered in Release: MLNX_DPDK 2.1._1
	Fixed in Release: MLNX_DPDK 2.2_1
-	Description: Fixed a faulty L3 and L4 checksums which were reported as bad in case packet is L2
	Key Words: L3 and L4 checksum of L2 packet
	Discovered in Release: MLNX_DPDK 2.1._1
	Fixed in Release: MLNX_DPDK 2.2_1
-	Description: Fixed an issue that showed some features as not supported although they were when DPDK was compiled with -j option
	Key Words: Parallel builds compilation
	Discovered in Release: MLNX_DPDK 2.1._1
	Fixed in Release: MLNX_DPDK 2.2_1
-	Description: Fixed an issue causing IPv6 resolution protocol to not work in case all-multicast options were not configured
	Key Words: IPv6 resolution protocol

Internal Ref.	Issue
	Discovered in Release: MLNX_DPDK 2.1._1
	Fixed in Release: MLNX_DPDK 2.2_1

5.2 ConnectX-3 PMD Bug Fixes

Table 6: ConnectX-3 PMD Bug Fixes

Internal Ref.	Issue
-	Description: Modified the function <code>priv_set_flags</code> (<code>priv</code> , <code>keep</code> , <code>flags</code>) behavior. Now the "keep" mask is no longer ignored.
	Key Words: Setting interface flags
	Discovered in Release: MLNX_DPDK 2.2_1.6
	Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Fixed compilation issues on RedHat 6.7.
	Key Words: Compilation issues
	Discovered in Release: MLNX_DPDK 2.2_2.7
	Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Fixed compilation issues with glibc 2.20 and ICC.
	Key Words: Compilation issues
	Discovered in Release: MLNX_DPDK 2.2_2.7
	Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Fixed DPDK on Windriver
	Key Words: Windriver OS support
	Discovered in Release: MLNX_OFED 3.2-x.x.x.x
	Fixed in Release: MLNX_OFED 3.3.x.x.x.x
-	Description: Fixed TX checksum offloading on KVM VM.
	Key Words: TX checksum offloading on KVM
	Discovered in Release: MLNX_OFED 3.2-x.x.x.x
	Fixed in Release: MLNX_OFED 3.3.x.x.x.x
-	Description: Fixed Virtual Machines (VM) with enabled Multicast Promiscuous mode do not receive the multicast traffic that other VMs on the same hypervisor are registered to.
	Key Words: Multicast Promiscuous mode and SR-IOV
	Discovered in Release: MLNX_OFED 2.4-x.x.x.x
	Fixed in Release: MLNX_OFED 3.0-x.x.x.x and above
-	Description: Fixed QP setup failure on Debian 3.16.7-ckt7-1
	Key Words: QP setup failure

Internal Ref.	Issue
	Discovered in Release: DPDK 2.1 inbox
	Fixed in Release: MLNX_DPDK 2.2_1.1
-	Description: Fixed an unpredicted behavior due to “cow” mechanism when an application used fork() or system call that were not related to the networking.
	Key Words: Memory corruption when fork() is used in the application
	Discovered in Release: DPDK 2.0 inbox
	Fixed in Release: MLNX_DPDK 2.0_2.8.4
-	Description: Fixed a wrong speed reporting when a 10Gb/s port was set as 1Gb/s (10Gb/s instead of 1Gb/s)
	Key Words: 1Gb/s port’s link reported as 10Gb/s
	Discovered in Release: DPDK 2.0 inbox
	Fixed in Release: MLNX_DPDK 2.0_2.8.4
-	Description: Fixed a multiple RX VLAN filters issue preventing multiple RX VLAN filters to function properly although all were configured. In this case, only the first one functioned properly.
	Key Words: Multiple RX VLAN filters
	Discovered in Release: DPDK 2.0 inbox
	Fixed in Release: MLNX_DPDK 2.0_2.8.4

5.3 DPDK v2.2 Bug Fixes

Table 6: DPDK v2.2 Bug Fixes

Internal Ref.	Issue
-	Description: Fixed an inconsistency issue of byte order in ethdev library when setting fdir's mask and flow entry causing the inputs of mask to be in big endian format
	Key Words: Byte order consistency of flow director
	Discovered in Release: DPDK 2.2
	Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Fixed compilation issues on RedHat 6.7.
	Key Words: Compilation issues
	Discovered in Release: DPDK 2.2
	Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Multiple changes in all DPDK libs to support latest gcc compilers when pedantic flag is enabled.

Internal Ref.	Issue
	Key Words: Power8 compilation with DEBUG mode enabled Discovered in Release: DPDK 2.2 Fixed in Release: MLNX_DPDK 2.2_3.9
-	Description: Added support for 100 Gb/s link rate Key Words: ConnectX-4 100G/b port link speed Discovered in Release: DPDK 2.2 Fixed in Release: MLNX_DPDK 2.2_1.6
-	Description: Fixed compilation failure with <code>-pedantic</code> on Power8 Key Words: Compilation on Power8 Discovered in Release: DPDK 2.2 inbox Fixed in Release: MLNX_DPDK 2.2_1.4
-	Description: Add support for 512 entries in RETA table Key Words: RETA table Discovered in Release: DPDK 2.2 inbox Fixed in Release: MLNX_DPDK 2.2_1.4

6 Change Log History

Table 7: Change Log History



NOTE: The changes are from the previous DPDK version on dpdk.org and not between two MLNX_DPDK versions. DPDK (dpdk.org) Release Notes can be found at: http://dpdk.org/doc/guides/rel_notes/

Driver	Changes
Rev 2.2_2.7 from Rev 2.2_1.6	
ConnectX-4 PMD, mlx5	<ul style="list-style-type: none"> • Major CPU usage performance optimizations • Performance improvements for messages $\geq 256B$ • Automatic scatter gather setting: RX according to MTU and TX is set to HW maximum • Added support for flow director drop queue • Replaced compilation options with command line parameters • Added support for ESX 6.0 and 5.5 SR-IOV for ConnectX-4 • HW TX VLAN insertion only (removed SW VLAN insertion) • Bug fixes
Rev 2.2_1.6 from Rev 2.2_1.4	
ConnectX-4 PMD, mlx5	<ul style="list-style-type: none"> • DPDK bug fixes
ConnectX-3 PMD, mlx4	<ul style="list-style-type: none"> • Bug fixes
Rev 2.2_1.4 from DPDK 2.2	
ConnectX-4 PMD, mlx5	<ul style="list-style-type: none"> • Added support for flow director filters (RTE_FDIR_MODE_PERFECT and RTE_FDIR_MODE_PERFECT_MAC_VLAN modes) • Single core and max performance optimizations • Added support for RX VLAN stripping • Added support for TX VLAN insertion (supported only with MLNX_OFED-3.2-1.5.0.1 and above) • Added callbacks to support link (up / down) changes • Added support for HW packet padding (supported only with MLNX_OFED-3.2-1.5.0.1 and above) • Added support for scattering FCS (supported only with MLNX_OFED-3.2-1.5.0.1 and above) • Added TX support for secondary processes • Added support for MLNX_OFED 3.2-1.0.1.1 and higher • DPDK fixes (see section Table 6: DPDK v2.2 Bug Fixes)
ConnectX-4 PMD, mlx4	<ul style="list-style-type: none"> • Added support for VMware ESX 6.0 U1
Rev 2.1_1.1 from DPDK 2.1 inbox	

Driver	Changes
ConnectX-4 PMD, mlx5	<ul style="list-style-type: none">• Added support for ConnectX®-4 and ConnectX®-4 LX NICs• Added support for MLNX_OFED 3.1-1.0.0• DPDK fixes (see section Table 6: DPDK v2.2 Bug Fixes)
Rev 2.1_1.1 from MLNX DPDK 2.0_2.8.4	
ConnectX-3 PMD, mlx4	<ul style="list-style-type: none">• Removed support for VMware ESX 5.5• Added support for Accelerated verbs – PMD does not include libibverbs and libmlx4